

Release note

Model Name	KX-TGP600 CE/UK
Existing version	11.000
New version	11.100

1. New or Enhanced Features

No	New or Enhanced item	Version
1-1	<p>Boot log enhancement</p> <ol style="list-style-type: none"> IPEI information is added Json format is supported <p>New configuration parameter: BOOTLOG_FORMAT</p>	11.100
1-2	Support for STIR/SHAKEN	11.100
1-3	Require password change at first login.	11.100

2. Fixed Issues

No	Fixed item	Version
2-1	No voice can be hear when SSRC is set as 0xffffffff in the RTP packets.	11.100
2-2	<p>Condition:</p> <ol style="list-style-type: none"> Logo file installed. Set the config (POWER_ON_ENABLE) to "Y". *) default = "N" 「Put UDT121/131 on charging base with the power off」 or 「Insert battery」 <p>After upgrading TGP600 to V9.000 or later (upgrading UDT131 to V07.00.001 or later), placing UDT131 on the charging stand, automatically powers on and starts up (when POWER_ON_ENABLE = "Y" is set), but does not complete startup and repeats restart.</p>	11.100
2-3	TPA68s automatically revert from configured default Flex Key page 2 to page 1 every time the TGP600 base station is rebooted (either soft reboot - SIP NOTIFY with check-sync or power cycle).	11.100
2-4	Rarely in between making calls, one of the TPA68 handsets presents "<<Mismatch Firmware>>" as the Handset Label after a call was completed.	11.100

3. Known Issues

No.	Known Issue	Fix version
3-1	None	-

4. Version Information

No.	Fixed issue
4-1	<p>TGP600: Ver.11.000 -> Ver.11.100</p> <p>[Handset Firmware Version]</p> <p>TPA60: V03.04.006 -> (no change)</p> <p>TPA65: V03.04.006 -> (no change)</p> <p>TPA68: V02.02.001 -> V02.02.006</p> <p>UDT121: V07.00.008 -> V07.01.003</p> <p>UDT131: V07.00.008 -> V07.01.003</p>